

## Warranty

SIMPSON ELECTRIC COMPANY warrants each instrument and other articles of equipment manufactured by it to be free from defects in material and workmanship under normal use and service, its obligation under this warranty being limited to making good at its factory any instrument or other article of equipment which shall within 90 days after delivery of such instrument or other article of equipment to the original purchaser be returned intact to it, or to one of its authorized service stations, with transportation charges prepaid, and which its examination shall disclose to its satisfaction to have been thus defective; this warranty being expressly in lieu of all other warranties expressed or implied and of all other obligations or liabilities on its part, and SIMPSON ELECTRIC COMPANY neither assumes nor authorizes any other persons to assume for it any other liability in connection with the sale of its products.

This warranty shall not apply to any instrument or other article of equipment which shall have been repaired or altered outside the SIMPSON ELECTRIC COMPANY factory or authorized service stations, nor which has been subject to misuse, negligence or accident, incorrect wiring by others, or installation or use not in accord with instructions furnished by the manufacturer.

### SIMPSON ELECTRIC COMPANY

*A Katy Industries Subsidiary*

853 Dundee Avenue, Elgin, Illinois 60120  
(312) 697-2260 • Cable SIMELCO • Telex 722416

IN CANADA: Bach-Simpson, Ltd., London, Ontario

IN ENGLAND: Bach-Simpson (U.K.) Ltd., Wadebridge, Cornwall

# OPERATOR'S MANUAL

## SIMPSON 260<sup>®</sup>-6XLP & 260-6XLPM VOLT-OHM-MILLIAMMETER

\*260 Is a registered trademark of The Simpson Electric Company.



This symbol on the nameplate means the product is Listed by Underwriters Laboratories Inc.



11½M582 (123.05)  
EFFECTIVE DATE: 1281

Part No. 6-110940

EDITION: 5TH

# TABLE OF CONTENTS

## SECTION I

<b>Introduction</b> .....	1-1
1.1 General .....	1-1
1.2 Overload Protection .....	1-1
1.3 Overload Circuit Reset .....	1-2
1.4 Accessories and Supplies .....	1-3
1.5 Technical Data .....	1-3
1.6 Test Leads .....	1-8
1.7 Safety Considerations .....	1-8

## SECTION II

<b>Installation</b> .....	2-1
2.1 General .....	2-1
2.2 Unpacking and Inspection .....	2-1
2.3 Warranty .....	2-1
2.4 Shipping .....	2-2
2.5 Power Source Requirements .....	2-2
2.6 Operating Position .....	2-3
2.7 Care .....	2-3

## SECTION III

<b>Controls, Connectors, and Indicators</b> .....	3-1
3.1 General .....	3-1
3.2 Front Panel .....	3-1

## SECTION IV

<b>Operation</b> .....	4-1
4.1 General .....	4-1

# Table of Contents

4.2 Safety Precautions .....	4-1
4.3 Movement Overload Protection .....	4-3
4.4 Adjust Pointer for Zero .....	4-3
4.5 Polarity Correction .....	4-3
4.6 Overload Protection Circuit and Battery Test .....	4-4
4.7 DC Voltage Measurement .....	4-4
4.8 AC Voltage Measurement .....	4-8
4.9 Direct Current Measurement .....	4-13
4.10 Resistance Measurement .....	4-15

## SECTION V

<b>Operator Servicing</b> .....	5-1
5.1 General .....	5-1
5.2 Battery and Fuse Replacement .....	5-1
5.3 Case Removal .....	5-3
5.4 Fuse Protection .....	5-5

## SECTION VI

<b>Servicing Instructions</b> .....	6-1
6.1 General .....	6-1
6.2 Replacement Parts and Schematic Diagram .....	6-1

## LIST OF TABLES

1-1 Technical Data .....	1-3
1-2 Items and Accessories Supplied with each Instrument .....	1-6
1-3 Additional Accessories .....	1-7
3-1 Controls and Connectors .....	3-1
6-1 Replacement Parts List .....	6-1

## Table of Contents

### LIST OF ILLUSTRATIONS

1-1	Simpson 260 Series 6XLP Volt-Ohm-Milliammeter .....	vi
1-2	Simpson 260 6XLPM Volt-Ohm-Milliammeter .....	vii
3-1	Front Panel .....	3-2
4-1	Typical Frequency Response, AC Voltage Ranges .....	4-7
4-2	Typical Frequency Response, Output Ranges .....	4-9
5-1	Battery and Fuse Compartment .....	5-2
5-2	Rear Interior (Case Removed) .....	5-4
6-1	Simpson 260-6XLP and 6XLPM Schematic Diagram .....	6-5

### NOTE

This Operator's Manual contains information essential to the operation of these Instruments. It must be kept with the Instrument at all times and not misplaced or discarded.

## SAFETY SYMBOLS



This marking, adjacent to another marking or a terminal or operating device, indicates that the operator must refer to an explanation in the Operating Instructions to avoid damage to the equipment and/or to avoid personal injury.

**WARNING**

The **WARNING** sign denotes a hazard. It calls attention to a procedure, practice, or the like, which if not correctly performed or adhered to could result in personal injury.

**CAUTION**

The **CAUTION** sign denotes a hazard. It calls attention to an operating procedure, practice, or the like, which if not correctly adhered to could result in damage to or destruction of part or all of the Instrument.

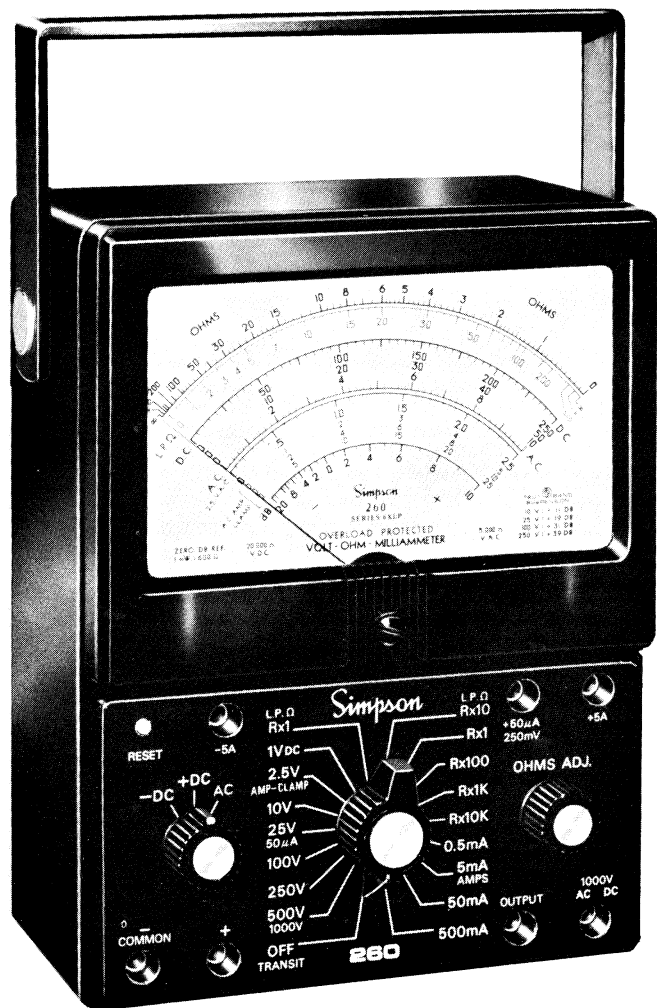


Figure 1-1. Simpson 260 Series 6XLP Volt-Ohm-Milliammeter.

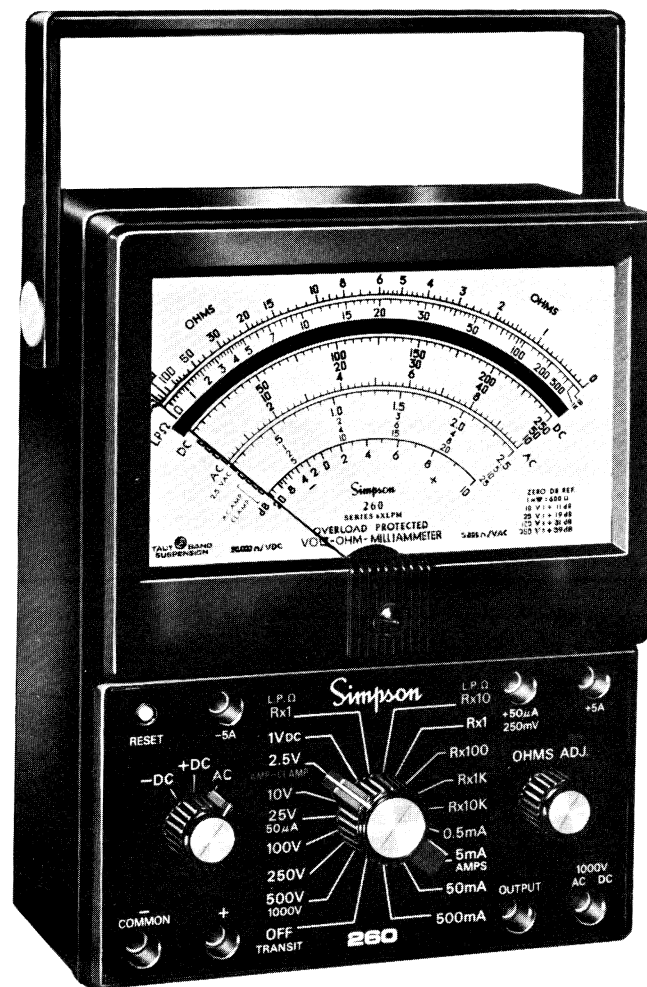


Figure 1-2. Simpson 260-6XLP Volt-Ohm-Milliammeter

## WARNING

These Instruments are designed to prevent accidental shock to the operator when properly used. However, no engineering design can render safe an Instrument which is used carelessly. Therefore, this manual must be read carefully and completely prior to making any measurements. Failure to follow directions can result in a serious or fatal accident.

**SHOCK HAZARD:** As defined in American National Standard, C39.5, Safety Requirements for Electrical & Electronic Measuring & Controlling Instrumentation, a shock hazard shall be considered to exist at any part involving a potential in excess of 30 volts rms (sinewave) or 42.4 VDC or peak, and where a leakage current from that part to ground exceed 0.5 milliampere, when measured with an appropriate measuring instrument defined in Section 11.6.1 of ANSI C39.5.

**NOTE:** The proper measuring instrument for the measurement of leakage current consists essentially of a network of a 1500 ohm non-inductive resistor shunted by a 0.15 microfarad capacitor connected between the terminals of the measuring instrument. The leakage current is that portion of the current that flows through the resistor. The Simpson Model 229-Series 2 AC Leakage Current Tester meets the ANSI C39.5 requirements for the measurement of AC leakage current and can be used for this purpose. To measure DC leakage current, connect a 1500 ohm non-inductive resistor in series with the 260-6XLP 0.5 mA range and use this as the measuring instrument.

## SECTION I INTRODUCTION

### 1.1 GENERAL

**1.1.1** The Simpson Volt-Ohm-Milliammeters 260 Series 6XLP and 6XLPM (hereafter referred to as the 260 s or the Instrument) are identical electrically and mechanically except that the Series 6XLPM is equipped with a mirrored dial to eliminate parallax.

**1.1.2** The 260 s are rugged, high performance, battery-operated Volt-Ohm-Milliammeters capable of making a wide variety of electrical measurements simply and accurately. Features are overload protection, conventional and low-power ohms, and a wide range coverage. The cases are made of high-impact (ABS) plastic, and are contemporarily styled. These features, in combination with the extended range coverage (Table 1-1) make these Instruments general-purpose portable or laboratory Instruments. They are well suited to servicing, production, inspection and engineering applications.

**1.1.3** The 260 s utilize the Simpson taut-band movement, which is self-shielding. The taut-band suspension provides a high degree of repeatability and is highly resistant to shock or vibration.

### 1.2 OVERLOAD PROTECTION

**1.2.1** All of the ranges, with the exception of the 5 Amps and 500/1000 VAC and VDC ranges, are protected by an electronic overload sensing circuit. The protection is from the usual overloads that could damage the Instrument. A transistorized circuit senses the voltage drop across the indicating instrument and actuates a relay when the voltage reaches approximately three times rated full-scale voltage. The sensing of the voltage drop is accomplished by use of a bridge network, so that overload protection is provided regardless of polarity. The relay operates at a uniform percent of overload since the indicating instrument circuit

## Introduction

is common to all ranges. When actuated by an overload, the relay contacts (which are in the COMMON circuit) latch open and remain open until the reset button on the front panel is pressed. The white reset button is located to the left of the —5A jack. An additional switch is opened when the relay is actuated; this switch opens the coil circuit of the relay and the electronic sensing circuit, and prevents continuous battery drain. Once the reset button has been pressed to make the Instrument operational again, the protective circuit is restored to its monitoring status, but does not draw any current from the battery (until another overload occurs). A 9-volt battery is used for both the RX10,000 ohms range and the protection circuit. The Instruments are designed so that the protective circuit will function normally as long as the RX10,000 ohms range can still be “zeroed.”

### WARNING

The 9-volt battery must be installed and tested before the Instrument is ready for use. Perform the overload test described in paragraph 4.6 to ensure proper overload operation prior to using the Instrument.

## 1.3 OVERLOAD CIRCUIT RESET

**1.3.1** When an overload of sufficient magnitude to trigger the protective circuit is applied to the Instrument, the reset button is tripped and will extend approximately 3/16 inch above the surface of the panel. To reset the Instruments for normal operation, first remove the overload and press the reset button. If the overload is not disconnected, pressing the reset button will not reset the overload protection circuit. Thus the protection continues until the Instrument leads are disconnected (or until the circuit fault is cleared).

## Introduction

### WARNING

The 260-6XLP is not protected from catastrophic type overloads where the damage due to overloads occurs within the response time of the protective relay, or from voltages above the maximum capability of the Instrument.

## 1.4 ACCESSORIES AND SUPPLIES

**1.4.1** All accessories and supplies required for the operation of the 260s are furnished with each instrument, and listed in the accompanying Table 1-2. (Replacement parts are listed in Table 6-1.)

## 1.5 TECHNICAL DATA

**1.5.1** Table 1-1 lists the technical specifications for the Simpson 260-6XLP and 6XLPM Volt-Ohm Milliammeters.

NOTE: Accuracy specifications apply to measurements made with the Instrument in a horizontal position (meter facing upward). Reference Conditions:  $+25^{\circ}\text{C} \pm 5^{\circ}\text{C}$ ; 45% to 75% relative humidity.

**Table 1-1. Technical Data**

<b>1. DC Voltage:</b>	
Ranges (full scale):	250 mV, 1.0V, 2.5V, 10V, 25V, 100V, 250V, 500V, and 1000V
Accuracy:	$\pm 2\%$ of full scale on all ranges
Sensitivity:	20,000 ohms/volt
<b>2. AC Voltage:</b>	
Ranges (full scale):	2.5V, 10V, 25V, 100V, 250V, 500V, and 1000V
Accuracy:	$\pm 3\%$ of full scale on all ranges
Sensitivity:	5000 ohms/volt
Frequency Response:	See curve in Figure 4-1.

## Introduction

### 3. Ohms Conventional:

Ranges: RX1, RX100, RX1k and RX10k  
 Ohms Center: 6, 600, 6000, and 60k ohm

Maximum Scale Reading: 1000 ohms (RX1)

Accuracy:  $\pm 2.5^\circ$  of an arc on the RX1 range;  $\pm 2.0^\circ$  of arc on all other ranges. The nominal open-circuit voltage for all ranges up to RX1k is 1.5V. The RX10k range has an open circuit voltage of 9V. The maximum current drawn from the 1.5V battery is 250 mA (RX1 with test leads shorted).

### 4. Low Power Ohms

Ranges: RX1 and RX10  
 Ohms Center: 20 and 200 ohms

Maximum Scale Reading: 1000 ohms (RX1)

Accuracy:  $\pm 2.5^\circ$  of arc. The maximum open-circuit voltage for the low power ohms ranges is 100 mV and the maximum measuring power is 0.125 mW. The battery quiescent current is 4.3 mA at RX1 and 0.43 mA at RX10.

### 5. DC Current:

Range (Full Scale)	Voltage Drop	Accuracy
0-50 $\mu$ A	250 mV	$\pm 1.0\%$ of F.S.
0-0.5 mA	250 mV	$\pm 2.0\%$ of F.S.
0-5 mA	252 mV	$\pm 2.0\%$ of F.S.
0-50 mA	252 mV	$\pm 2.0\%$ of F.S.
0-500 mA	400 mV	$\pm 2.0\%$ of F.S.
0-5A	250 mV	$\pm 2.0\%$ of F.S.

### 6. Output Jack: Voltage (AC)

Ranges (Full Scale): 2.5V, 10V, 25V, 100V, 250V  
 Frequency Response: See curves in Figure 4-2

## Introduction

### Decibels (dB)

#### Range (AC)

2.5V  
 10V  
 25V  
 100V  
 250V

Accuracy:

### 7. Rated Circuit-To-Ground Voltage\* (float potential):

1000V AC/DC (1500V-peak) max.

### 8. Readout:

4½ inch, 50  $\mu$ A (full scale) taut-band meter.

### 9. Overload Capability:

The voltage, current, and the resistance measuring circuits are overload protected by an electronic sensing circuit which is activated at approximately three times the full scale reading. The 500V, 1000V and 5A ranges are not overload protected.

### 10. Power Requirements:

Two Batteries: One 1.5V cell, NEDA 13F. One 9.0V alkaline cell, NEDA 1604A. Refer to Paragraph 5.2 for installation instructions.

### 11. Fuses:

1 Ampere, 250 Volts, type 3 AG; 2 Amperes, Littelfuse Type 620301, 1KV or 600 Volts, Bussman BBS

### 12. Dimensions:

5¼" wide x 7" long x 3¼" high (133 x 178 x 79 mm)

### 13. Weight:

2½ pounds (1.14 kg)

\*Per ANSI C39.5 April 1974 — "The specified voltage with respect to ground which may be safely and continuously applied to the circuits of an instrument."

## Introduction

**Table 1-2. Items and Accessories Supplied With Each Instrument**

---

<b>Quantity</b>	<b>Description</b>	<b>Catalog Number</b>
1	Test Lead Set — One red and one black, 4 ft. long, each with combination probe tip and removable rubber-sleeved alligator clip at one end and banana plug on opposite end.	00125
*1	1.5 volt, D Cell, NEDA 13F	
*1	9.0 volt, ALKALINE Cell, NEDA 1604A	
1	Operator's Manual	6-110940

---

*\*Batteries are standard items replaceable from local retail stores.*

---

## Introduction

**Table 1-3 Additional Accessories**

---

<b>Description</b>	<b>Number</b>
Ever-Redy Carrying Case	00805
Vinyl Carrying Case	01818
Deluxe Carrying Case	00812
Utility Vinyl Case	00549
Model 150-2 Amp-Clamp	00545

---



## Introduction

### 1.6 TEST LEADS

**1.6.1** Each Instrument is furnished with one pair of test leads 4 feet long. For easy polarity identification, one lead is black and the other red. The test lead wire consists of a large number of fine strands so as to be very flexible.

**1.6.2** The insulation of the wire is of a high-grade rubber and is more than adequate for the highest voltage that the Instrument is intended to measure. The red and black test leads have probe tips which are threaded near the base. Alligator clips may be screwed on or off either test lead.

### 1.7 SAFETY CONSIDERATIONS

**1.7.1** This Operator's Manual contains cautions and warnings alerting the user to hazardous operating and servicing conditions. This information is flagged by CAUTION or WARNING headings throughout this publication, where applicable, and is defined at the front of the manual under SAFETY SYMBOLS. To ensure the safety of operating and servicing personnel and to retain the operating conditions of the Instrument, these instructions must be adhered to.

## SECTION II INSTALLATION

### 2.1 GENERAL

**2.1.1** This section contains information and instructions for the installation and shipping of the 260 6XLP and 6XLPM. Included are unpacking and inspection procedures, warranty, shipping, power source requirements, operating position and care.

### 2.2 UNPACKING AND INSPECTION

**2.2.1** Examine the shipping carton for any sign of damage. Inspect the Instrument and packing material for obvious damage from mechanical shock, water leakage, or other causes. Check the electrical performance as soon as possible. If there is any indication of damage, file a complaint with the carrier immediately. Also check that all accessories are included (Table 1-2). Save the shipping carton and packing materials for future storing or shipping of the Instrument.

**2.2.2** After unpacking the Instrument, a 1.5V battery and a 9V battery will be found packed in separate envelopes in the box with the Instrument and test leads. Two alligator clips, for the test leads, are also packed in a polyethylene bag. (Refer to Section V for instructions on how to open the battery compartment and install the batteries.) A pair of test leads, one black and one red, are also included.

### 2.3 WARRANTY

**2.3.1** The Simpson Electric Company warranty policy is printed on the inside front cover of this manual. Read it carefully prior to requesting a warranty repair.

## Installation

**NOTE:** For assistance of any kind, including help with the Instrument under warranty, contact the nearest Authorized Service Center for instructions (listed on the last pages of this manual). If it's necessary to contact the factory directly, give full details of the difficulty and include the Instrument model number and date of purchase. Service data or shipping instructions will be mailed promptly. If an estimate of charges for non-warranty or other service work is required, a maximum charge estimate will be quoted. This charge will not be exceeded without prior approval.

### 2.4 SHIPPING

**2.4.1** Pack the Instrument carefully and ship it prepaid to the proper destination. Insure the Instrument.

### 2.5 POWER SOURCE REQUIREMENTS

**2.5.1** There are two batteries in the ohmmeter circuits: one is a NEDA 13F D size cell that furnishes 1.5 volts for all ranges up to RX1K; one is a NEDA 1604A alkaline battery which furnishes 9 volts for the RX10K range; it also is used by the overload sensing circuit. The 1.5 volt D cell is held in place with two spring contact clips. Make certain to observe correct polarity when replacing the 1.5 volt D cell. The 9 volt battery is held in place with a spring clip, but contact is made with a polarized connector.

## Installation

### 2.6 OPERATING POSITION

**2.6.1** The Instrument may be set horizontally on its rubber feet or vertically on its back and operated in either position. The Instrument can also be set at an inclined angle by positioning a stand under the unit.

### 2.7 CARE

**2.7.1** Immediately clean all spilled materials from the Instrument and wipe dry. If the spillage is corrosive, use a suitable cleaner to neutralize the corrosive action, and remove the spillage.

**2.7.2** Whenever the Instrument is not in use, rotate the range selector switch to the OFF/TRANSIT position (260-6XLP).

**2.7.3** Whenever possible, avoid prolonged exposure or usage in areas which are subject to temperature and humidity extremes, vibration or mechanical shock, dust or corrosive fumes, or strong electrical or electromagnetic interferences.

**2.7.4 Monthly Care:** Verify Instrument accuracy by performing operational checks using known, accurate, stable sources. If proper calibration equipment is not available, contact your nearest Simpson Authorized Service Center. (Refer to last pages of this manual.) If the Instrument has not been used for 30 days, check the batteries for leakage and replace if necessary.

**2.7.5 Annual Care:** It is recommended that the Instrument be returned annually to your nearest Simpson Authorized Service Center, or to the factory, for an overall check, adjustment, and calibration.

## Installation

**2.7.6 Storage:** When the Instrument is not in use, store it in a room free from temperature extremes, dust, corrosive fumes, and mechanical vibration or shock. If storage time is expected to exceed 30 days, remove batteries.

---

Courtesy of:  
Simpson260.com

With thanks to: Jerry Brown

## SECTION III

### CONTROLS, CONNECTORS, AND INDICATORS

#### 3.1 GENERAL

**3.1.1** All operating and adjustment controls, connectors, and indicators are described in this section along with a list (Table 3-1) describing their function. Become familiar with each item prior to operating the instrument.

#### 3.2 FRONT PANEL

**3.2.1** The 260 s have a large, easy-to-read, 4½" indicating instrument. Below the indicating instrument are three controls and seven circuit jacks. Switch positions and circuit jacks are marked in white, blue, green, and red characters printed on a sub-surface vinyl panel overlay. The colors on the overlay correspond to the dial graphics.

---

**Table 3-1. Controls and Connectors**

- 1. Range Switch:** The range switch has 18 positions. It may be turned to any position from either direction. There are seven voltage positions, four direct current positions, six resistance positions and an OFF/TRANSIT position. Two of the resistance positions are for Low Power Ohms.
- 2. Function Switch:** The function switch has three positions: —DC, +DC and AC. To measure DC current or DC voltage, set the function switch at —DC or +DC, depending on the polarity of the signal applied across the test leads. For resistance measurements, the switch may be in either the +DC or —DC position. The function switch can reverse the test leads without need for removing the test leads from the circuit under test. To measure AC voltage, set the function switch into its AC position.

## Controls, Connectors, and Indicators

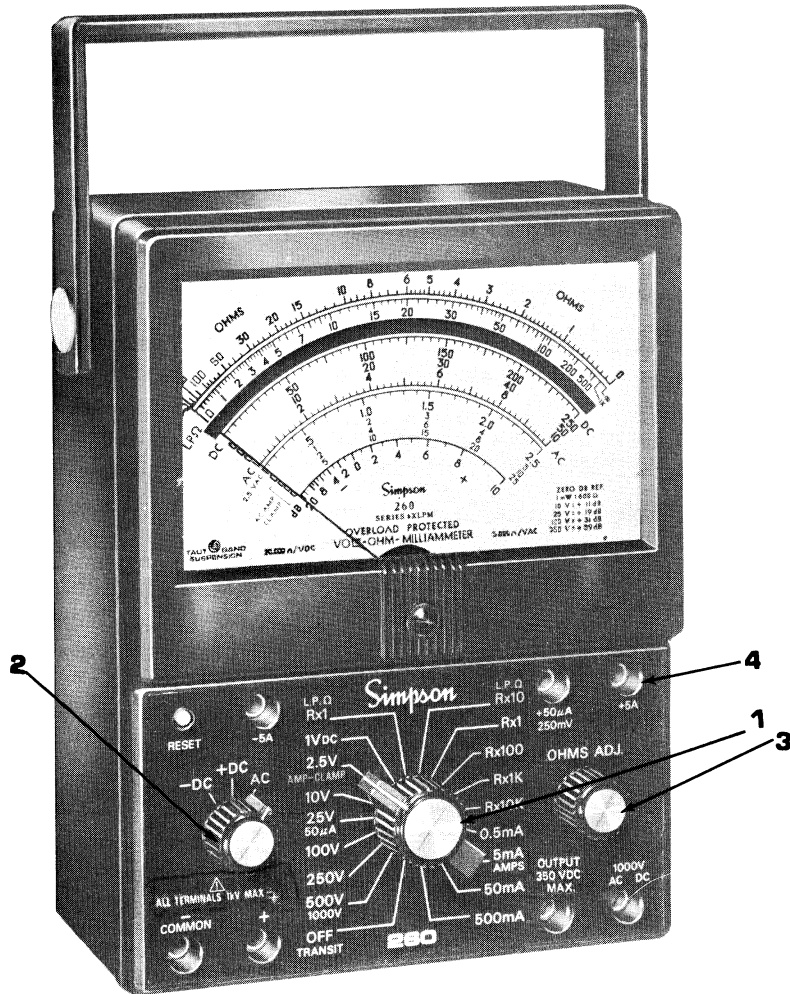


Figure 3-1. Front Panel

## Controls, Connectors, and Indicators

3. **Ohms Adjust:** The ohms adjust control is a variable resistor in the ohmmeter circuit, which permits adjustment at infinity ( $\infty$ ) and at 0 for the low-power and conventional ohms ranges, respectively.
4. **Circuit Jacks:** There are seven jacks on the front panel marked with the functions they represent. These are the connections for the test leads. The elbow prods of the test leads are plugged into the proper jacks for the circuit and range desired for each application. At the lower left are —COMMON and + jacks. The black test lead is connected to —COMMON for all circuits and ranges except the 5 amperes DC range. The red test lead is used in the + jack for all functions and ranges, except those designated by the other jacks. Across the top of the panel are three jacks individually marked —5A, dual-marking of +50  $\mu$ A/250 mV at a single jack, and +5A.

For the 50 microampere or 250 millivolt DC range, the red test lead is connected to this dual-marked jack. For the 5 ampere DC range, the black test lead and the red test lead are connected to the —5A and +5A jacks, respectively. At the lower right are the OUTPUT and 1000V jacks. For all OUTPUT ranges, and for 1000 volts AC or DC, the red test lead is connected to the appropriate jack with the black lead in the —COMMON jack. The small white button to the left of the —5A jack is the reset button of the overload protection circuit.

## SECTION IV

### OPERATION

#### WARNING

Before proceeding with the operation of the 260, review the SHOCK HAZARD definition printed on page viii of the manual. Also, do not use this Instrument and its accessories on induction heating, X-ray machines, or power sub-stations where high voltage and low impedance equipment is used.

#### 4.1 GENERAL

**4.1.1** This section of the manual contains information required to use and operate the 260 in a safe and proper manner.

#### 4.2 SAFETY PRECAUTIONS

**4.2.1** The 260 s are intended for use only by personnel qualified to recognize shock hazards and trained in the safety precautions required to avoid possible injury.

**4.2.2.** Do not work alone when making measurements of circuits where a shock hazard might exist. Notify a nearby person that you are making, or intend to make such measurements.

**4.2.3** Locate all voltage sources and accessible current paths before making measurement connections. Be sure the equipment is properly grounded and the right rating and type of fuse(s) is installed. Set the Instrument to the proper range before applying power.

### Operation

**REMEMBER:** Voltage might appear unexpectedly in defective equipment. An open bleeder resistor can result in a capacitor retaining a dangerous charge. Turn the power off and discharge all capacitors before connecting or disconnecting the Instrument.

**4.2.4** Inspect the test leads for cracks, breaks or crazes in the insulation, prods, and connectors before each use. If any defects are noted, replace the test leads immediately.

**4.2.5** Do not make measurements in a circuit where corona is present. Corona can be identified by a pale blue color emanating from sharp metal points in the circuit, or by a buzzing sound, or by the odor of ozone. In rare instances, such as around germicidal lamps, ozone might be generated as a normal function. Ordinarily, the presence of ozone indicates the presence of high voltage and probably an electrical malfunction.

**4.2.6** Hands, shoes, floor, and workbench must be dry. Avoid making measurements under humid, damp, or other environmental conditions that could affect the dielectric withstanding voltage of the test leads or Instrument.

**4.2.7** For maximum safety, do not touch test leads or Instrument while power is applied to the circuit under test.

**4.2.8** Use extreme caution when making measurements where a dangerous combination of voltages could be present, such as in an r-f amplifier.

**4.2.9** Do not make measurements using test leads of lesser safety than those originally furnished with the Instrument.

**4.2.10** Do not touch any object which could provide a current path to the common side of the circuit under test or powerline

## Operation

ground. Always stand on a dry, insulated surface capable of withstanding the voltage being measured.

### 4.3 MOVEMENT OVERLOAD PROTECTION

**4.3.1** In addition to the overload sensing circuit and fuse, a varistor gives additional protection to the indicating instrument movement. The varistor limits the current through the moving coil in the event of extreme overload and transients. However, no overload protection system is completely fool-proof and misapplication on high voltage circuits can damage the Instrument. Always exercise care and caution to protect both yourself and the Instrument.

### 4.4 ADJUST POINTER FOR ZERO

**4.4.1** With the Instrument in the operating position, check the pointer for zero indication at the left end of the scale when there is no input. If pointer is off zero, adjust the screw located in the meter cover below the center of the dial. Use a small screwdriver to turn the screw slowly clockwise or counterclockwise until the pointer is exactly over the zero mark at the left end of the scale. With the indicating pointer set on the zero mark, reverse the direction of rotation of the zero adjuster. Rotate the zero adjuster a sufficient amount to introduce mechanical freedom or "play" but insufficient to disturb the position of the indicating pointer. This procedure will avoid disturbances to the zero setting by subsequent changes in temperature, humidity, vibration, and other environmental conditions.

### 4.5 POLARITY CORRECTION

**4.5.1** When making DC measurements with the test leads connected to the + and —COMMON jacks, polarity can be reversed with the function switch without reversing the test leads.

## Operation

When making measurements on the 50  $\mu\text{A}/250$  mV range, or 5A range, polarity can be corrected only by reversing the test leads.

**NOTE:** Change the range switch or function switch positions only when the power to the circuit being measured is turned off or when the test leads are disconnected. In addition to ensuring safety, this practice will eliminate arcing at switch contacts and prolong the life of the Instrument.

### 4.6 OVERLOAD PROTECTION CIRCUIT AND BATTERY TEST

- a. Rotate the range switch to the RX10 k position.
- b. Set the function switch to the — DC position.
- c. Plug the black test lead into the —COMMON jack.
- d. Touch the other end of the black test lead to the 50  $\mu\text{A}/250$  mV jack.
- e. If the reset button trips, the 9-volt battery is in good condition.
- f. No damage will occur as a result of this test.

### 4.7 DC VOLTAGE MEASUREMENT

#### WARNING

Prior to making voltage measurement, review the SAFETY PRECAUTIONS listed in paragraph 4.2.

#### 4.7.1 Measuring DC Voltage: 0-250 millivolts

- a. Set the function switch at +DC.
- b. Plug the black test lead into the —COMMON jack and the red test lead into the +50  $\mu\text{A}/250$  mV jack.
- c. Set the range switch at the 25V (50  $\mu\text{A}$ ) position.

## Operation

- d. Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side of the circuit.
- e. Turn power on and read the voltage on the black scale marked DC and use the figures marked 0-250. Read directly in millivolts.
- f. Turn the power off and disconnect the test leads. Return the range switch to the OFF/TRANSIT position.

### 4.7.2 Measuring DC Voltage: 0-1 through 0-500 volts

- a. Set the function switch to +DC.
- b. Plug the black test lead into the —COMMON jack and the red test lead into the + jack.
- c. Set the range switch at one of the seven voltage range positions marked 1V, 2.5V, 10V, 25V, 100V, 250V or 500V. When in doubt about the approximate voltage present, always use a sufficiently high voltage range to protect the Instrument. If the voltage reading is within the limits of a lower range, the switch then may be set to that range to obtain a more accurate reading.
- d. Be sure the power is off in the circuit being measured and all capacitors have been discharged.
- e. Connect the black test lead to the negative side of the circuit being measured and red test lead to the positive side of the circuit.

## Operation

- f. Turn on the power of the circuit and read the voltage on the black scale marked DC. For the 2.5V and 25V ranges, use the 0-250 figures and divide the reading by 100 and 10 respectively. For the 10V, and 250V ranges, read the 0-10 and 0-250 figures directly. For the 500V range, use the 0-50 figures and multiply the reading by 10. For the 100V range use the 0-10 figures and multiply by 10. For the 1V range, use the 0-10 figures and divide by 10.
- g. Turn power off, disconnect test leads and return the range switch to the OFF/TRANSIT position.

### 4.7.3 Measuring DC Voltage: 0-1000 Volts

#### WARNING

Use extreme care when working with high voltage circuits. For maximum safety, avoid touching the Instrument or test leads while power is on in the circuit being measured.

- a. Set the function switch at +DC.
- b. Set the range switch at 1000V (dual position with 500V).
- c. Be sure the power is off in the circuit being measured and all capacitors have been discharged.
- d. Plug the black test lead into the —COMMON jack and the red test lead into the 1000V jack. Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side.
- e. Turn on power in the circuit being measured.

## Operation

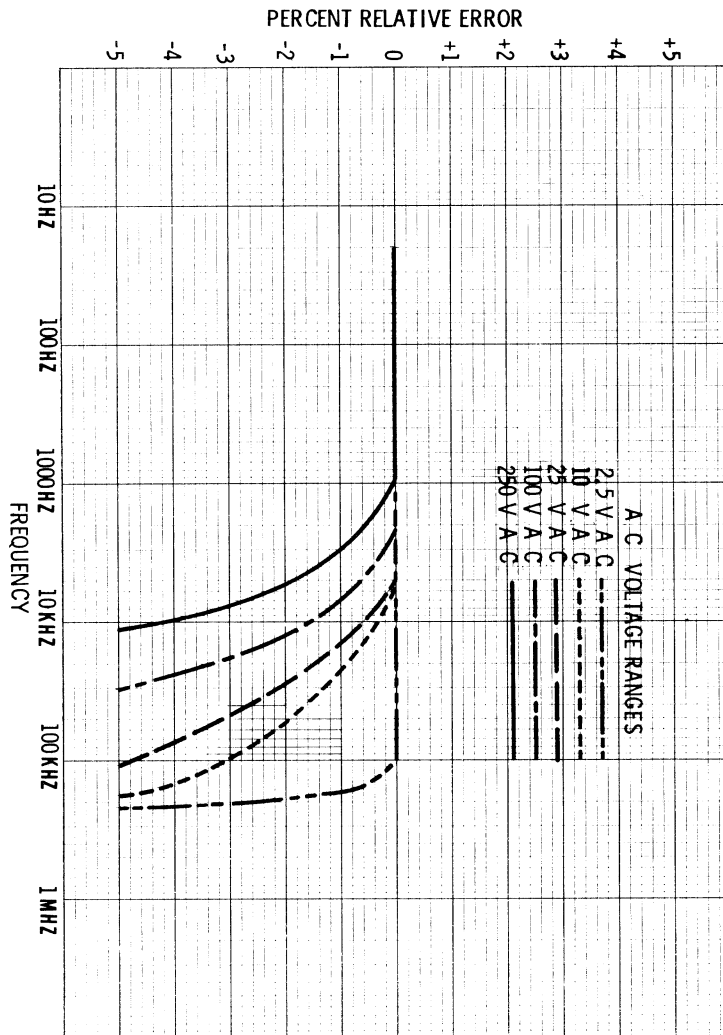


Figure 4-1. Typical Frequency Response, AC Voltage Ranges

## Operation

- Read the voltage on the black scale marked DC, using the 0-10 figures. Multiply the reading by 100.
- Turn the power off, disconnect the test leads and return the range switch to the OFF/TRANSIT position.

## 4.8 AC VOLTAGE MEASUREMENT

### WARNING

Prior to making voltage measurements, review the SAFETY PRECAUTIONS listed in paragraph 4.2.

### 4.8.1 Measuring AC Voltage

NOTE: The Simpson 260-6XLP and 6XLPM respond to the full-wave average value of an AC waveform. They are calibrated in terms of the rms value of a pure sine wave. If the waveform is nonsinusoidal, the reading might be either higher or lower than the true rms value, and could result in a substantial error. Also, accuracy is lessened at higher input frequencies (Figure 4-1).

- Set the function switch at AC.
- Set the range switch at one of the six voltage range positions marked 2.5V, 10V, 25V, 100V, 250V or 500V. When in doubt about the approximate voltage in the circuit being measured, always use a sufficiently high voltage range as a protection to the Instrument. If the voltage is within a lower



## Operation

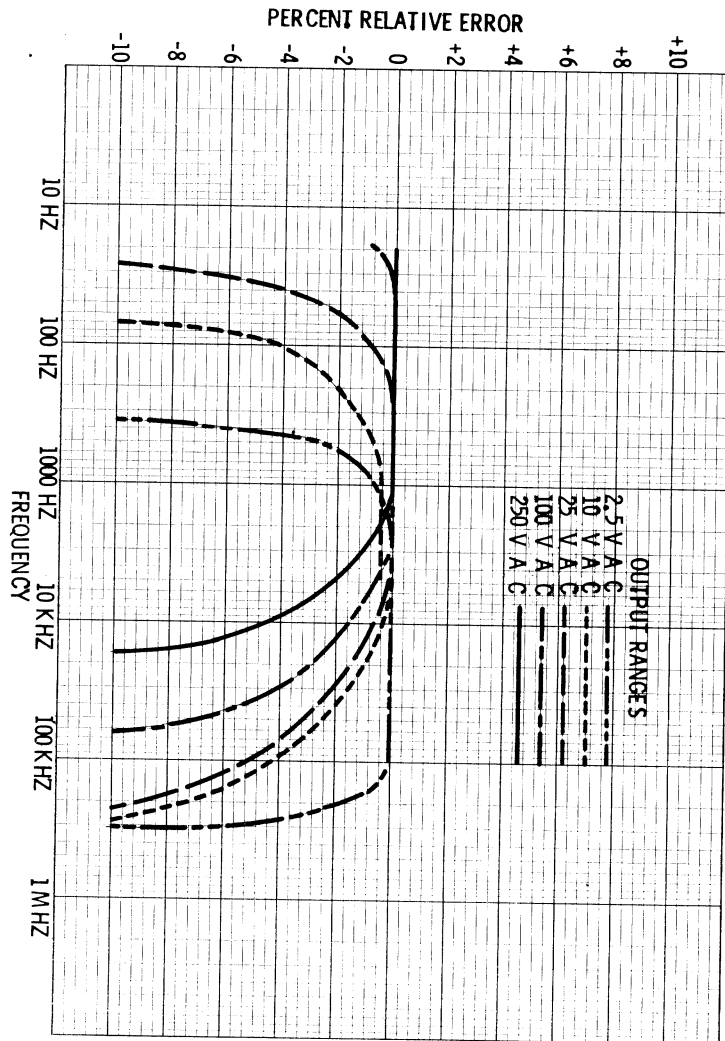


Figure 4-2. Typical Frequency Response, Output Ranges

## Operation

range the switch then may be set at a lower range to obtain a more accurate reading.

- Plug the black test lead into the —COMMON jack and the red test lead into the + jack.
- Be sure the power is off in the circuit being measured and all the capacitors have been discharged.
- Connect the test lead across the voltage source with the black lead on the ground side.
- Turn on the power in the circuit being measured and read the voltage on the red scale marked AC.
- For the 0-2.5V range, read the value directly on the red scale marked 2.5 VAC. For the 10V, 25V, 100V, 250V and 500V ranges, read the red scale marked AC and use the black figures immediately above the scale. For the 10V and 250V ranges, read directly using the 0-10 and 0-250 figures respectively. For the 500V range, read directly on the 0-50 figures and multiply the reading by 10. For the 100V range, read the 0-10 figures directly and multiply the reading by 10. For the 25V range, use the 0-250 figures and divide by 10.
- Turn power off, disconnect the test leads and return the range switch to the OFF/TRANSIT position.

### 4.8.2 Measuring AC Voltage: 0-1000 Volts

#### WARNING

For maximum safety, avoid touching the Instrument or the test leads while the power is on in the circuit being measured.

- Set the function switch at AC.

## Operation

- b. Set the range switch at 1000V (dual position with 500V).
- c. Plug the black test lead into the —COMMON jack and the red test lead into the 1000V jack.
- d. Be sure the power is off in the circuit being measured and that all its capacitors have been discharged. Connect the test leads to the circuit with the black lead on the ground side.
- e. Turn on the power in the circuit being measured.
- f. Read the voltage on the red scale marked AC. Use the 0-10 figures and multiply by 100.
- g. Turn power off, disconnect the test leads and return the range switch to the OFF/TRANSIT position.

### 4.8.3 Output Voltage and Decibel Measurements

#### (1) Measuring Output Voltage:

Often it is necessary to measure the AC component of a voltage consisting of a mixture of AC and DC voltages, as in amplifier circuits. The 260 s have a 0.1  $\mu$ f, 400 volt capacitor in series with the OUTPUT jack. The capacitor blocks the DC component of the voltage in the test circuit, but passes the AC component. The blocking capacitor alters the AC response of each Instrument at low frequencies. (Figure 4-1 for frequency response.)

**CAUTION**

When using the OUTPUT mode, do not connect the Instrument to a circuit whose DC voltage component exceeds 350 volts.

- a. Set the function switch at AC.

## Operation

- b. Plug the black test lead into the —COMMON jack and the red test lead into the OUTPUT jack.
- c. Set the range switch at one of the range positions marked 2.5V, 10V, 25V, 100V or 250V.
- d. Be sure the power is off in the circuit being measured.
- e. Connect the test leads across the circuit being measured with the black test lead to the ground side.
- f. Turn on the power in the test circuit. Read the output voltage on the appropriate AC voltage scale. For the 0-2.5V range, read the value directly on the red scale marked 2.5V. For the 10V, 25V, 100V or 250V ranges, use the red scale marked AC and read the black figures immediately above the scale.

#### (2) Measuring Decibels:

To read voltages in terms of decibels, use the decibel dB scale on the bottom of the dial, marked from —20 to +10. Read the dB scale by first following the instructions for measuring AC. When the range switch is set on the 2.5V position, read the dB scale directly. The dB readings on the scale are referenced to zero dB power level of 0.001 watt into 600 ohms, or 0.775 VAC across 600 ohms. For the 10V range, read the dB scale and add +11 dB to the reading. For the 25V range, read the dB scale and add 19 dB to the reading. On the 100V range, read the dB scale and add +31 dB to the reading; on the 250V range, add +39 dB to the reading.

## Operation

### 4.9 DIRECT CURRENT MEASUREMENTS

#### WARNING

- While the circuit is energized do not change the setting of the Function or Range switches. **Never disconnect the test leads.**
- Always turn the power off and discharge all the capacitors before resetting the switches, or disconnecting the leads.
- Always connect the Instrument in series with the ground side of the circuit under measurement and never exceed the circuit to ground voltage (Table 1-1, item 7).

#### 4.9.1 Measuring Direct Current: 0-50 Microamperes

- a. Set the function switch at +DC.
- b. Plug the black test lead into the —COMMON jack and the red test lead into the +50  $\mu$ A/250V jack.
- c. Set the range switch at the 25V (50  $\mu$ A) position.
- d. Be sure the power is off in the circuit being measured and all capacitors are discharged.
- e. Open the circuit in which the current is to be measured. Connect the red test lead at the positive side and the black test lead at the negative side.
- f. Turn the power on and read the current on the black DC scale. Use the 0-50 figures to read directly in microamperes.

## Operation

- g. Turn the power off, disconnect test leads and return the range switch to the OFF/TRANSIT position.

NOTE: In all direct current measurements make certain the power to the circuit being tested has been turned off before connecting and disconnecting test leads or restoring circuit continuity.

#### 4.9.2 Measuring Direct Current: 0-0.5 through 0-500 Milli-amperes

- a. Set the function switch at +DC.
- b. Plug the black test lead into the —COMMON jack and the red test lead into the +jack.
- c. Set the range switch at one of the four range positions marked 0.5 mA, 5 mA, 50 mA or 500 mA.
- d. Turn the power off, discharge all capacitors, and open the circuit in which the current is being measured. Connect the Instrument in series with the circuit. Connect the red test lead to the positive side and the black test lead to the negative side.
- e. Turn on the power to the circuit under test.
- f. Read the current in milliamperes on the black DC scale marked 0-50. For the 0.5 mA or 5 mA ranges, divide the reading by a factor of 100 or 10, respectively. Read the 50 mA range directly. Multiply the reading on the 500 mA range by a factor of 10.

## Operation

g. Turn power off, disconnect test leads and return the range switch to the OFF/TRANSIT position.

### 4.9.3 Measuring Direct Current: 0-5 Amperes

- a. Plug the black test lead into the  $-5A$  jack and the red test lead into the  $+5A$  jack.
- b. Set the range switch at 5 AMPS (dual position with 5 mA).
- c. With power OFF, open the circuit in which the current is being measured. Connect the Instrument in series with the circuit. Connect the red test lead at the positive side and the black test lead at the negative side.

d. Turn on power in the circuit under test.

NOTE: The function switch has no effect on polarity for the 5 AMPS range.

- e. Read current directly on the black DC scale. Use the 0-50 figures; divide by 10 to read amperes.
- f. Turn power off and disconnect the test leads. Return the range switch to the OFF/TRANSIT position.

## 4.10 RESISTANCE MEASUREMENT

### WARNING

Before making resistance measurements, remove all power to the circuit under test. Discharge all capacitors.

**4.10.1** The 260 s have six resistance ranges. Two are Low Power Ohms, and the other four are conventional ohm ranges powered by two batteries. The Low Power Ohms ranges are used for accurate and safe measurements of resistance in semiconductors and integrated circuits. The low open-circuit voltage of 100

## Operation

millivolts assures that the circuit being measured will not be damaged or have its resistance affected by conducting diodes. Depending on the range selected, the open-circuit voltage for the conventional ohms ranges is 1.5V or 9V.

**4.10.2** A single OHMS ADJ control is provided for all the resistance ranges. This control compensates for variations in battery voltage and allows the user to zero the Instrument prior to measuring resistance.

### 4.10.3 Measuring Resistance: Using low Power Ohms Ranges

- a. Turn the range switch to the desired resistance range, mark in blue. Turn the function switch to either the  $-DC$  or  $+DC$  position.
- b. Plug the black test lead into the  $-COMMON$  jack and the red test lead into the  $+jack$ .
- c. With the test leads separated, rotate the OHMS ADJ control to set the Instrument pointer at infinity (  $\infty$  ) on the blue low power ohms arc. If the pointer cannot be adjusted to infinity (  $\infty$  ), replace the 1.5V battery. Refer to paragraph 5.4 for instructions.
- d. Connect the test leads to the circuit whose resistance is to be measured. Read the resistance on the blue arc and multiply it by the factor indicated on the range switch.
- e. Disconnect the test leads and return the range switch to the OFF/TRANSIT position.

## Operation

NOTE: When the Instrument is not in use, never leave the range switch in the low power ohms position, because power is drawn continuously from the 1.5V battery.

### 4.10.4 Measuring Resistance: Using Conventional Ohms Ranges

- a. Turn the range switch to the desired range and the function switch to either the +DC or —DC position.
- b. Plug the black test lead into the —COMMON jack and the red test lead into the + jack.
- c. Connect the ends of the test leads to short-circuit the Instrument's resistance measuring circuit.
- d. Rotate the OHMS ADJ control to set the Instrument pointer to 0 on the black ohms arc. If the pointer cannot be adjusted to 0, replace the 1.5V battery. Replace the 9V battery if the RX10k range cannot be adjusted to full-scale (zero ohms). For battery replacement, refer to paragraph 5.2.
- e. Disconnect ends of test leads and connect to component being measured.

## Operation

- f. Read the resistance on the black ohms scale. Multiply the reading by the factor indicated on the range switch.
- g. Disconnect ends of test leads and return the range switch to the OFF/TRANSIT position.

Courtesy of:  
Simpson260.com

With thanks to: Jerry Brown

## SECTION V

### OPERATOR SERVICING

#### 5.1 GENERAL

**5.1.1** The Simpson 260-6XLP and 6XLPM have been designed carefully and constructed with high-quality components. By providing reasonable care, and following the instructions in this manual, the user can expect a long, useful service life from these Instruments.

#### WARNING

Prior to opening the Battery compartment cover, disconnect the test leads from live circuits.

#### 5.2 BATTERY AND FUSE REPLACEMENT

**5.2.1** The batteries and 1-ampere fuse are located inside an isolated compartment at the top-rear of the Instrument case. To open the compartment, proceed as follows:

**NOTE:** If replacement of the 2-amp high current interrupting fuse is necessary, the Instrument case must be removed (see paragraph 5.4 and Figure 5-2).

- Place the Instrument face down on a soft, padded surface.
- Unscrew the single captivated screw on the cover.
- Remove the cover from the case and set it aside. Batteries and fuse now can be replaced.

#### Operator Servicing

**5.2.2** Battery replacement is necessary: whenever the Instrument cannot be adjusted to infinity ( $\infty$ ) with open test leads on the Low Power Ohmmeter ranges, or with shorted test leads on the conventional ohmmeter ranges. If these adjustments cannot be made, replace the 1.5V, D size cell. If the ohms adjustment cannot be made on the Rx10K range or the reset button does not trip on overload circuit and battery test, replace the 9-volt battery.

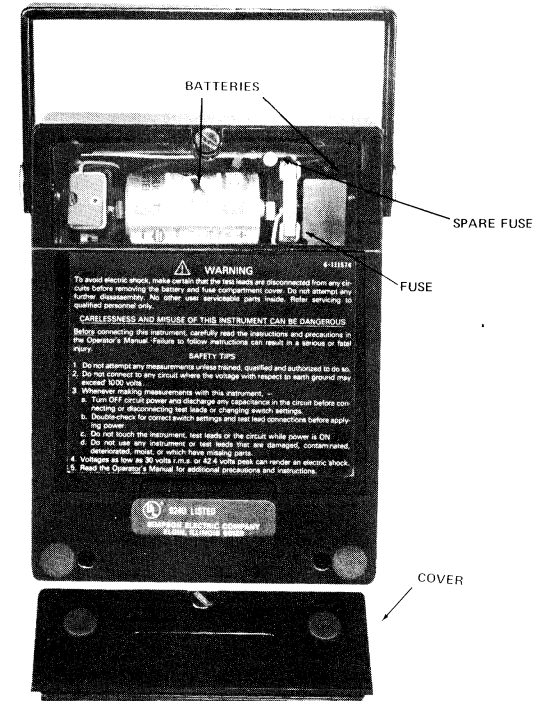


Figure 5-1. Battery and Fuse Compartment

**5.2.3** The procedure for replacing batteries is as follows:

- a. To remove the D size cell, grasp the battery at the center and pull directly up. To install new cell, insert the —end first: push against the —terminal spring clip, and then gently push the + side of the cell into place.
- b. To remove the 9-volt battery, first withdraw battery and mating connector from the compartment.
- c. Remove the connector from the old battery and connect it to new battery.
- d. Put the new battery into the compartment.
- e. Place the connector leads so they rest between the cavity walls and clear the fuse terminals. Place the extended leads between the battery holder and top wall of the case.

**5.2.4** One-ampere or two-ampere fuse replacement is necessary when there is no meter deflection on any of the DC, AC VOLTS or OHMS ranges, but the DC AMPS range operates properly.

**5.2.5** The procedure for replacing the 1-ampere fuse is as follows:

- a. Pull the defective fuse from its retaining spring clips (fuse holder).
- b. Snap in the replacement fuse and re-install cover.

**NOTE:** A spare fuse is located in a cavity next to the fuse clip. Use only if proper replacement fuse is not available; save the internal spare for an emergency.

## 5.3 CASE REMOVAL

**5.3.1** Whenever maintenance other than battery and 1-ampere

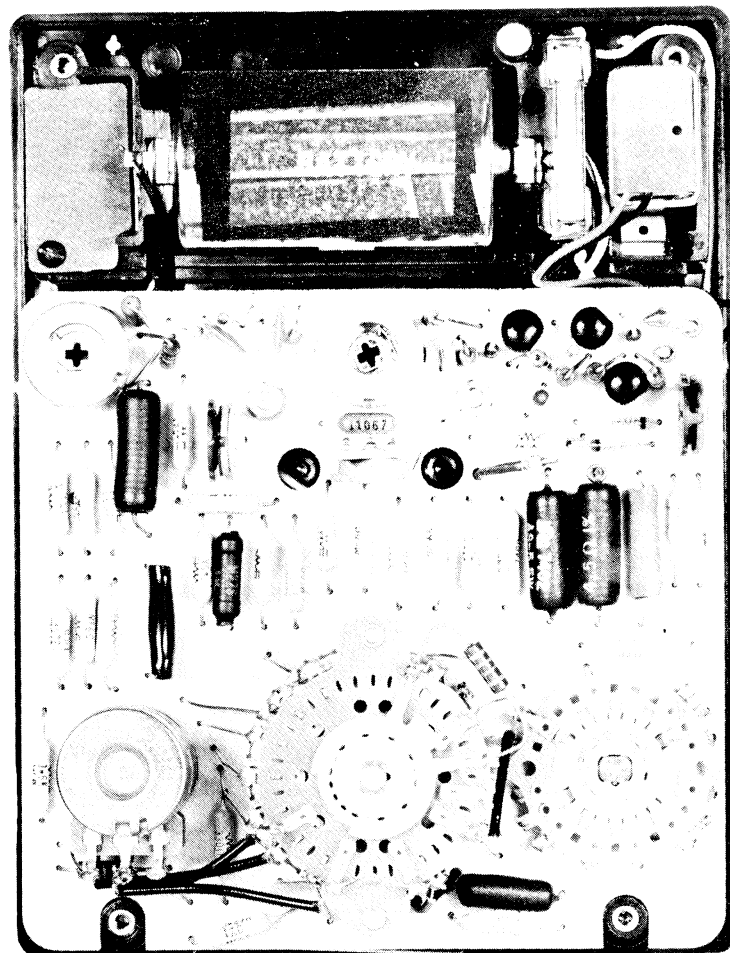


Figure 5-2. Rear Interior (Case Removed)

## Operator Servicing

fuse replacement is required, remove the Instrument from its case. The procedure is as follows:

- a. Place the Instrument face down on a soft, padded surface.
- b. Remove the battery and fuse compartment cover, located at the top-rear of the 260-6XLP case (refer to paragraph 5-3). Unscrew the 4 screws located at the 4 corners of the case.
- c. Lift the case off the Instrument and set it aside. Maintenance now can be performed on the Instrument (Figure 5-2).

### 5.4 FUSE PROTECTION

**5.4.1** A 1 Amp 250 Volt quick-acting and 2 Amp high voltage, high interruption capacity fuse are connected in series with the input circuit as additional protection to the VOM, especially to the relay contacts, as a protection against excessive energy fault current, such as a power line overload. It is possible that the fuse(s) may burn out, in addition to the opening of the relay contacts, at high energy overloads on the VOM's low impedance circuits.

**5.4.2** Replace the 1 Amp fuse with a Littelfuse Type 312001 only to prevent the 2 Amp high interruption capacity fuse from opening on nominally high overload.

**5.4.3** If the Instrument fails to indicate, the 1 Amp or the 2 Amp fuses may be burned out. (Refer to Paragraph 5.2 for fuse replacement.) A 1 Amp spare fuse is furnished with each Instrument. (Both 1 Amp fuses are located in the battery and fuse compartment.) The 2 Amp fuse is located on the instrument panel under the printed circuit board.

**WARNING**

These servicing instructions are for use by qualified personnel only. To avoid electrical shock, do not perform any servicing other than that contained in the operating instructions unless you are qualified to do so.



## SECTION VI

### SERVICING INSTRUCTIONS

#### 6.1 GENERAL

##### NOTE

This Instrument must be serviced by qualified personnel. To aid in troubleshooting, a schematic diagram is enclosed. The replacement parts list (Table 6-1) describes the components and refers to Simpson part numbers. Reference Symbol numbers correlate the components shown on the schematic diagram with the parts list.

**6.1.1** The following information is provided as an adjunct to the overall text contained in this manual and should be read and understood thoroughly prior to ordering replacement parts for the Instrument.

#### 6.2 REPLACEMENT PARTS AND SCHEMATIC DIAGRAM

**6.2.1** To obtain replacement parts, address order to the nearest Authorized Service Center (listed on the last pages of this manual). Refer to paragraph 2.3.1 for ordering instructions.

**Table 6-1. Replacement Parts**

Reference Symbol	Description	Part No.
R-1	Potentiometer, 100K $\Omega$	5-116715
R-2	Potentiometer, 2K $\Omega$	5-116716
R-3	Potentiometer, 3K $\Omega$	5-116717
R-4	Resistor, 5 Meg $\Omega$	5-110454
R-5	Resistor, 3 Meg $\Omega$	1-113432
R-6	Resistor, 1.5 Meg $\Omega$	1-113536
R-7	Resistor, 300K $\Omega$	1-113995
R-8	Resistor, 150K $\Omega$	1-117895
R-9	Resistor, 30K $\Omega$	1-115042
R-10	Resistor, 15K $\Omega$	1-113347
R-11	Resistor, 332 $\Omega$	5-116941
R-12	Resistor, 3.29K $\Omega$	5-117112
R-13	Resistor, 505 $\Omega$	5-116731
R-14	Resistor, 45.5 $\Omega$ (Bobbin)	10-675462
R-15	Resistor, 4.5 $\Omega$ (Wirewound)	5-116728
R-16	Resistor, 0.45 $\Omega$ (Wirewound)	5-116727
R-17	Resistor, 0.05 $\Omega$ Shunt, 5A (Calibrate in VOM)	3-812003
R-18	Resistor, 7.5 Meg $\Omega$	5-111668
R-19	Resistor, 2.5 Meg $\Omega$	5-111669
R-20	Potentiometer (Dual) 600 Ohms Front, 10K $\Omega$ Rear	5-116752
R-21	Resistor, 1.6K $\Omega$	5-116289
R-22	Resistor, 22.3 $\Omega$ (Wirewound), 3W	5-119565
R-23	Resistor, 286 $\Omega$	5-117111
R-24	Resistor, 620 $\Omega$	1-110649
R-25	Resistor, 8.2K $\Omega$	1-111030
R-26	Resistor, 54.2K $\Omega$	5-116725
R-27	Resistor, 3.47K $\Omega$	5-116753
R-28	Resistor, 1.84K $\Omega$	5-116723
R-29	Resistor, 4.68K $\Omega$	5-116718
R-30	Resistor, 89.5 $\Omega$	5-116722
R-31	Resistor, 515 $\Omega$	5-116732
R-32	Resistor, 5 $\Omega$ (Wirewound), 5W	5-119566
R-33	Resistor, 3 $\Omega$ (Bobbin)	10-675466
R-34	Resistor, 1.25 Meg $\Omega$	5-115068
R-35	Resistor, 750K $\Omega$	5-116726
R-36	Resistor, 375K $\Omega$	1-113364
R-37	Resistor, 75K $\Omega$	1-117258
R-38	Resistor, 37.5K $\Omega$	5-116719
R-39	Resistor 7.5K $\Omega$	5-116678
R-40	Potentiometer, 3K $\Omega$	5-116714
R-41	Resistor, 4K $\Omega$	5-114835
R-42	Resistor, 4K $\Omega$	5-114835
R-43	Potentiometer, 3K $\Omega$	5-116714
R-44	Resistor, 10K $\Omega$	5-118615
R-45	Resistor, 470K $\Omega$	1-114227

### Replacement Parts

R-46	Resistor, 10K $\Omega$	5-118615
R-47	Resistor, 3.9K $\Omega$	5-118614
R-48	Resistor, 33 K $\Omega$	5-118620
R-49	Resistor, 3.3K $\Omega$	5-118608
R-50	Resistor, 10K $\Omega$	5-118615
C-1	Capacitor, 0.1 $\mu$ F, 400V	1-113733
C-2	Capacitor, 0.01 $\mu$ F, 50V	5-113215
C-3	Capacitor, 0.01 $\mu$ F, 50V	5-113215
C-4	Capacitor, 0.005 $\mu$ F, 500V	5-111427
C-5	Capacitor, 1 $\mu$ F, 35V	5-116713
D-1	Diode, Germanium	5-115665
D-2	Diode, Germanium	5-115665
D-3	Diode, Germanium	1-115970
D-4	Diode, Germanium	1-115970
D-5	Diode, Germanium	1-115970
D-6	Diode, Germanium	1-115970
D-7	Diode, Germanium	1-115970
D-8	Diode, Silicon	5-114005
D-9	Diode, Silicon	5-114005
V-1	Varistor, Silicon	1-110670
V-2	Varistor, Silicon	5-115289
Q1	Transistor, NPN SE6002	5-114463
Q2	Transistor, NPN SE6002	5-114463
Q3	Transistor, PNP 2N3638	5-114106
F-1	Fuse, 1 Amp, 250V 3AG (1 1/4 " x 1/4 ") Quick Acting	1-112507
F-2	Fuse, 2 Amp, Littelfuse Type 620301, 1 KV or 600V, Bussmann BBS	5-119056
RY-1	Relay	5-116768
	Function Switch, Knob	10-863468
	Range Switch, Knob	10-863465
	Ohms Adjust Knob	10-863470
	Case Assembly, Complete (Including Handle, Less Battery Compartment Cover)	10-862883

### Replacement Parts

Battery Compartment Cover Assembly	10-560212
Carrying Handle for Case	5-116711
Rubber Bumper Plug	5-115039
Front Panel Overlay	6-110938
Indicating Instruments with:	
Panel Assembly 260-6XLP	D13727
260-6XLPM	D13728
Cover Assembly for	
Indicating Instrument	10-560217
Probe Tip Leads, one red and one black	00125
Label, UL Listing	6-110977
Label, Battery and Fuse Data	6-110956
Label, Warning	6-111844

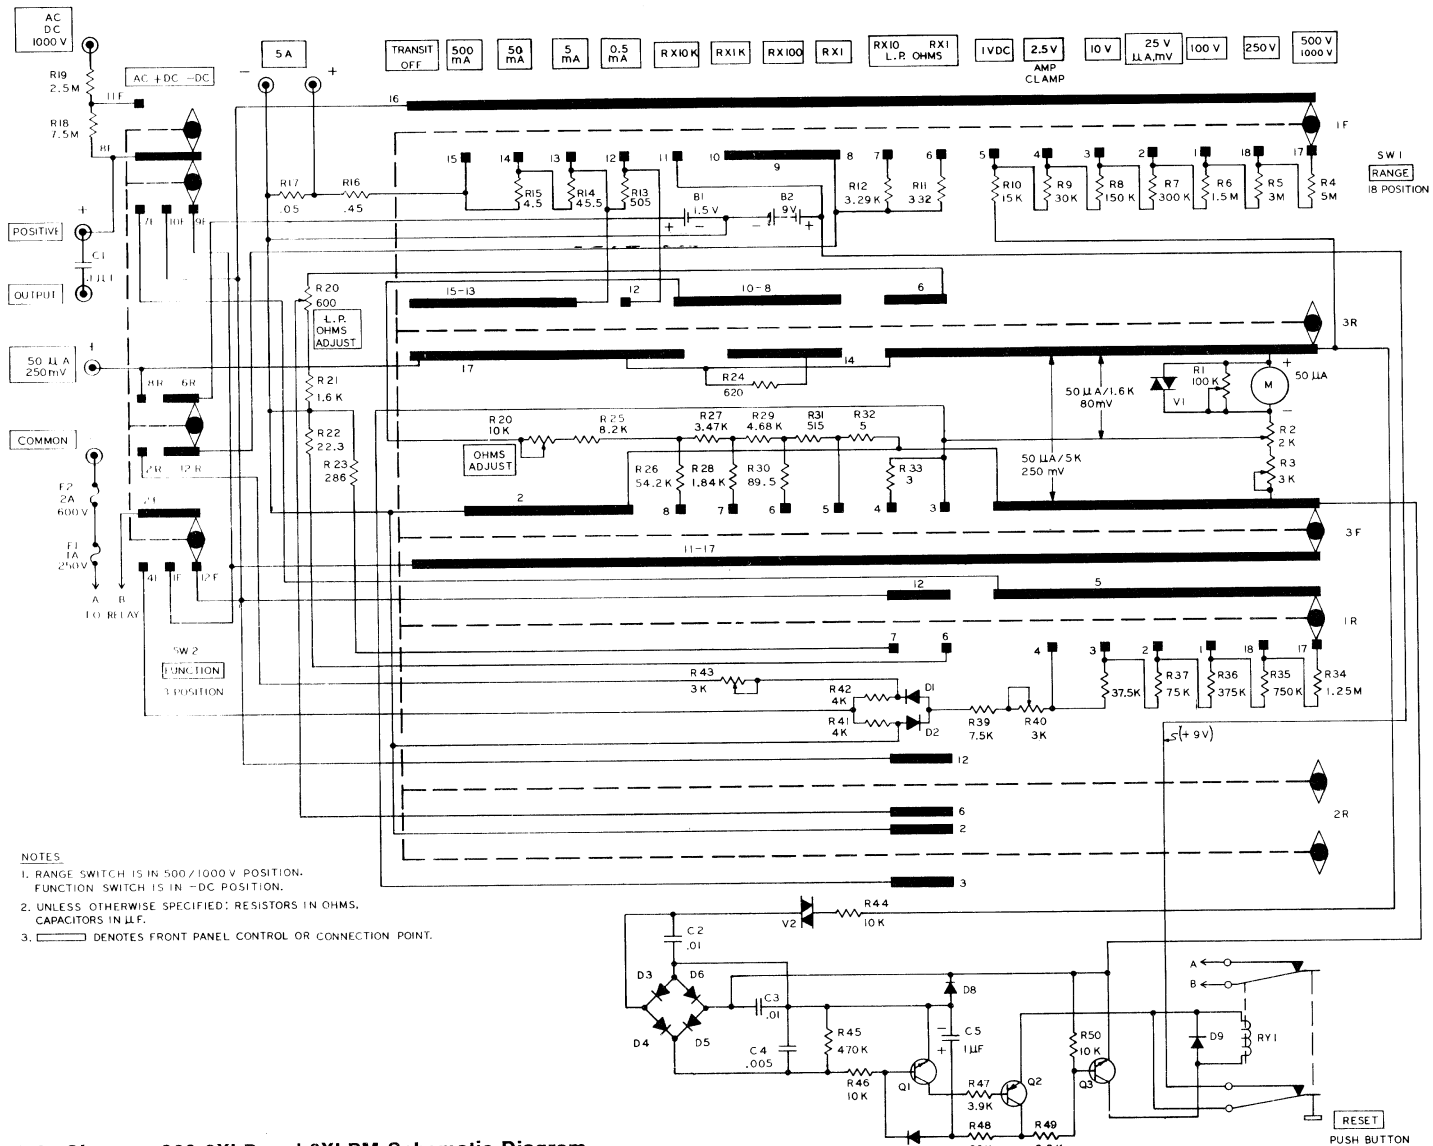


Figure 6-1. Simpson 260-6XLP and 6XLP Schematic Diagram